

(See Fig. 21)

IT IS IMPORTANT TO CHECK CABLE ROUTING
PRIOR TO ASSEMBLING AND OPERATING LIFT

BOTH CABLES THAT RUN TO EACH
CROSSMEMBER ON THE NON PUMP SIDE MUST
RUN ALONG THE BOTTOM PULLEYS

IF THESE 2 CABLES ARE PRE INSTALLED
INCORRECTLY ON THE TOP PULLEYS PLEASE
SEE THE INSTRUCTION BELOW

- REMOVE SMALL ALLEN BOLT AND CYLINDER NUT TO REMOVE THE CABLE GUIDE PLATE




- SLIDE EACH CABLE OUT FROM THE CYLINDER RAM PLATE



- REMOVE 4 HEX BOLTS



- REMOVE CABLES AND RE-INSTALL ALONG THE CORRECT PULLEYS
- PLEASE NOTE CABLE #4 and #2 RUN ALONG THE BOTTOM PULLEYS
- RE-INSTALL HARDWARE IN REVERSE ORDER

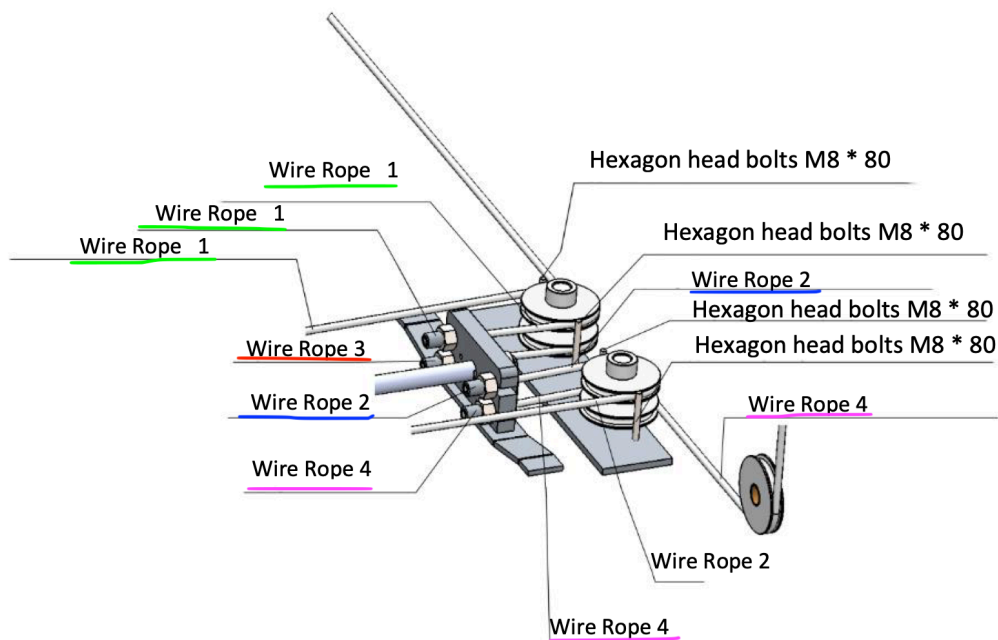

(See Fig. 21)